

Assembly instruction Series Z

B 05.10.05
4885/Sas


No.9087

Tools and materials required:

Stanley blade
Scissors, Screw driver
Crimp tool (see table below)
Spanner SW 13 (74Z-0-0-37)
Soldering iron
Solder

Cable entry: 71 Z 0 - 7 - 21 / - 22
for straight and right angle connectors

This connector is supplied in 2 parts.	Suitable cables	RG 213/U / RG 214/U	
	Centre contact:	soldered	
	Braid:	cavity D	
	Crimp tool:	3 D (violet)	

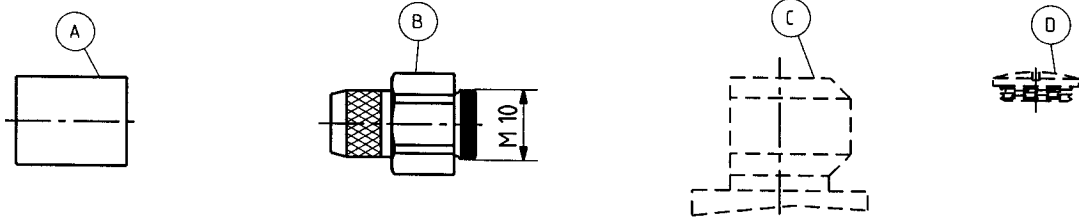

	<p>Slide ferrule A onto cable. Prepare cable according to diagram. CAUTION: Do not damage braid and inner conductor of cable!</p>
	<p>Splay out braid and insert cable in connector body B. Ensure that braid lies above the crimp neck.</p>
	<p>Slide ferrule A over braid and crimp as close to connector body B as possible.</p>
	<p>Final assembly according to: Fig.1 = straight connector Fig.2 = right angle connector</p> <p>Screw prepared cable with entry parts A and B into connector head C and tighten fully (11 Nm). Solder inner conductor to contact and screw on cover D.</p>

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F.lead-assembly on your behalf.
We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER + SUHNER AG CH-9100 HERISAU


Deutscher Text: siehe Rückseite

Benötigte Hilfsmittel:

Stanley Messer
 Schere Schraubenzieher
 Klemmwerkzeug (siehe Tabelle)
 Gabelschlüssel SW 13 (74Z-0-0-37)
 LötKolben
 Lötzinn

Kabeleinführung: 71 Z 0 - 7 - 21 / -22
 für Gerade- und Winkelverbinder

Dieser Verbinder wird in 2 losen Teilen geliefert.	Geeignete Kabel:	RG 213/U / RG 214/U	
	Innenleiter:	gelötet	
	Aussenleiter:	Aussparung D	
	Klemmwerkzeug:	3 D (violett)	

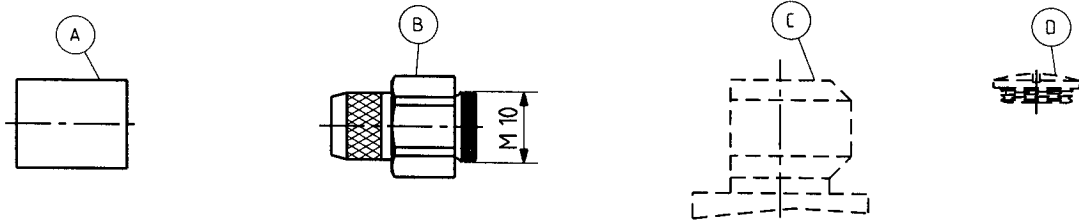

	<p>Hülse A auf das Kabel schieben. Kabel gemäss Figur abisolieren. ACHTUNG: Innenleiter, Abschirmung und Dielektrikum nicht beschädigen!</p>
	<p>Abschirmung leicht aufspreizen und Kabel in gehäuse b einführen. Abschirmung muss über Klemmhals liegen.</p>
	<p>Hülse A über die Abschirmung schieben und möglichst nahe am Gehäuse B klemmen.</p>
	<p>Montage gemäss: Fig.1 = Geradeverbinder Fig.2 = Winkelverbinder</p> <p>Kabeleinführung, bestehend aus A und B in Gehäuse C einschrauben und fest anziehen (11Nm). Innenleiter verlöten und Deckel D einschrauben.</p>

SUHNER verfügt über gut ausgebildete Fachkräfte und rationelle Einrichtungen kompletter HF-Verbindungsleitungen. Wir montieren Ihre Verbinder zu wirtschaftlichen Preisen! Wenden Sie sich an unsere Vertreter.



HUBER + SUHNER AG CH-9100 HERISAU

for English text see overleaf